


1 FACILITIES BUILDING ID #1595
HA.1 SCALE: NONE

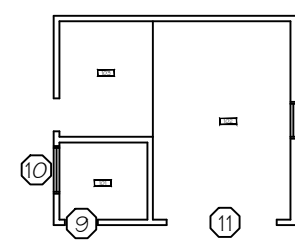

2 FACILITIES BUILDING ID #1596
HA.1 SCALE: NONE

- KEY ABATEMENT NOTES -

- 1 REMOVE AND DISPOSE OF APPROXIMATELY 2,302 SQUARE FEET OF ASBESTOS-CONTAINING FLOOR TILE AND ASSOCIATED MASTIC
- 2 REMOVE AND DISPOSE OF EIGHT (8) WINDOW UNITS (96 LINEAR FEET) WITH ASBESTOS-CONTAINING INTERIOR CAULK
- 3 REMOVE AND DISPOSE OF 12 WINDOW UNITS WITH ASBESTOS-CONTAINING EXTERIOR CAULK AND INTERIOR/EXTERIOR GLAZING
- 4 REMOVE AND DISPOSE OF SEVEN (7) WINDOW UNITS (84 LINEAR FEET) WITH ASBESTOS-CONTAINING EXTERIOR GLAZING
- 5 REMOVE AND DISPOSE OF APPROXIMATELY FOUR (4) SQUARE FEET OF ASBESTOS-CONTAINING WHITE ROPE GASKET ASSOCIATED WITH THE FLUE
- 6 REMOVE AND DISPOSE OF APPROXIMATELY 300 LINEAR FEET OF ASBESTOS-CONTAINING TAN/GREY EXTERIOR EXPANSION JOINT CAULK
- 7 REMOVE AND DISPOSE OF APPROXIMATELY 75 SQUARE FEET OF NON-ASBESTOS CEILING SYSTEM
- 8 STABILIZE LOOSE, FLAKING, PEELING PAINT TO THE POINT OF RIGIDITY AND ENCAPSULATE WITH A LEAD ENCAPSULANT - SEVEN (7) EXTERIOR METAL OVERHEAD DOOR FRAME(S)
- 9 REMOVE AND DISPOSE OF ONE (1) DOOR WITH ASBESTOS-CONTAINING INTERIOR GLAZING ASSOCIATED WITH VISION PANEL
- 10 REMOVE AND DISPOSE OF ONE (1) WINDOW UNIT WITH ASBESTOS-CONTAINING EXTERIOR GLAZING
- 11 STABILIZE LOOSE, FLAKING, PEELING PAINT TO THE POINT OF RIGIDITY AND ENCAPSULATE WITH A LEAD ENCAPSULANT - ONE (1) EXTERIOR METAL OVERHEAD DOOR FRAME

- GENERAL NOTES -

1. ALL WORK SHALL BE COORDINATED WITH THE STATE OF NEW JERSEY, DEPARTMENT OF TRANSPORTATION AND USA ENVIRONMENTAL MANAGEMENT, INC.
2. ALL INTERIOR ASBESTOS ABATEMENT WORK SHALL BE CONDUCTED WITHIN A NEGATIVE PRESSURE ENCLOSURE AND IN ACCORDANCE WITH THE CONTRACT DOCUMENTS.
3. RESILIENT COVERINGS (FLOOR TILE) SHALL BE REMOVED IN ACCORDANCE WITH THE RESILIENT FLOOR COVERING INSTITUTE'S (RFCI), "RECOMMENDED WORK PRACTICES FOR REMOVAL OF RESILIENT FLOOR COVERINGS" AND IN ACCORDANCE WITH THE STATE OF NEW JERSEY, DEPARTMENT OF HEALTH "REMOVING VINYL ASBESTOS TILE IN NEW JERSEY".
4. WORK ASSOCIATED WITH FLOOR TILE: THE CONTRACTOR SHALL SUBMIT THE STATE OF NEW JERSEY, DEPARTMENT OF HEALTH "CONTRACTOR INFORMATION FOR NON-FRIABLE ASBESTOS WORK ACTIVITIES--EXEMPTION REQUEST" AND SUBSEQUENT 10-DAY NOTIFICATION OF NON-FRIABLE ASBESTOS WORK ACTIVITIES AS REQUIRED BY STATE OF NEW JERSEY, DEPARTMENT OF HEALTH.
5. CEILING SYSTEM CONSISTS OF LESS THAN ONE PERCENT (<1%) ASBESTOS GYPSUM PAPER DRYWALL AND ASSOCIATED JOINT COMPOUND. THE SYSTEM IS NOT AN ASBESTOS-CONTAINING MATERIAL.
6. PERFORM LEAD PAINT STABILIZATION, DEBRIS CLEAN-UP, COMPONENT REMOVAL, AND DISPOSAL, IN ACCORDANCE WITH ALL APPLICABLE FEDERAL, STATE AND LOCAL REGULATIONS AND THE CONTRACT DOCUMENTS.
7. LEAD ENCAPSULANT SHALL BE TINTED TO MATCH EXISTING SUBSTRATE COLORS.

- LEGEND -

- C S E DECONTAMINATION UNIT: TWO (2) OR THREE (3) STAGE, AS INDICATED
- CRITICAL BARRIER LOCATION
- AIR SAMPLE LOCATION
- AIR FILTRATION DEVICE LOCATION
- AIR FILTRATION DEVICE EXHAUST
- ~ INGRESS/EGRESS AND WASTE ROUTE
- XXX ROOM NUMBERS

Rev:	Date:	By:

USAEMI
Project Number:
21-020024-02

Scale:
AS NOTED

Date:
10-1-2021

Checked by:
RR

Drawn by:
WWJ

William Weigartner, Jr., Project Designer
Certificate No. NAET159532

USA Environmental Management, Inc.
344 West State Street
Trenton, NJ 08618
609.656.2101

Deptford Maintenance Yard
Superior Wary (Block 200.1, Lot 6)
Deptford Twp., Gloucester Co., NJ

Drawing Title:
Facilities
Building ID
#1595 &
#1596

Drawing No.
HA.1

Environmental, Engineering & Construction
Asbestos and Lead Paint Related Work

Sheet: 1 of 1